


## TYPE K: 600 through 10,000 Amperes

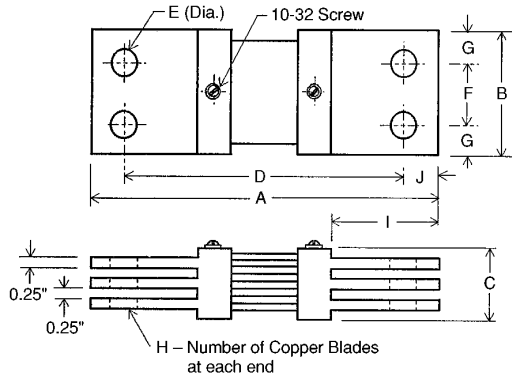

### TYPE K: 50 mV

Catalog Number	AMP	A	B	C	D	E	F	G	H	I	J
K-1000-50	1000	9.06	3	1.50	7.46	0.53	1.50	0.75	2	2.72	0.79
K-1200-50	1200	9.06	3	1.50	7.46	0.53	1.50	0.75	2	2.72	0.79
K-1500-50	1500	9.06	3	2	7.46	0.53	1.50	0.75	3	2.72	0.79
K-2000-50	2000	9.06	4	2	7.46	0.53	2	1	3	2.72	0.79
K-2500-50	2500	15.62	4	3	11.85	0.65	2	1	3	6.00	1.87
K-3000-50	3000	15.62	4	3	11.85	0.65	2	1	4	6.00	1.87
K-4000-50	4000	15.62	5	3	11.85	0.81	2	1.50	4	6.00	1.87
K-5000-50	5000	15.62	5	4	11.85	0.81	2	1.52	5	6.00	1.87
K-6000-50	6000	15.62	6	4	12.36	0.81	2.75	1.62	5	6.00	1.64
K-7500-50	7500	15.62	6	4	12.36	0.81	2.75	1.62	6	6.00	1.64
K-8000-50	8000	15.62	6	4	12.36	0.81	2.75	1.62	6	6.00	1.64
K-10000-50	10000	15.86	8	4	12.86	1.06	3.50	2.25	6	6.11	1.50

### TYPE K: 100 mV

Catalog Number	AMP	A	B	C	D	E	F	G	H	I	J
K-600-100	600	12	3	1.50	10.50	0.53	1.50	0.75	2	3.37	0.75
K-750-100	750	12	3	1.50	10.50	0.53	1.50	0.75	2	3.37	0.75
K-800-100	800	12	3	1.50	10.50	0.53	1.50	0.75	2	3.37	0.75
K-1000-100	1000	12	3	2	10.50	0.53	1.50	0.75	3	3.37	0.75
K-1200-100	1200	12	4	2	10.50	0.53	2	1	3	3.37	0.75
K-1500-100	1500	18.50	4	3	15	0.65	2	1	3	6.25	1.75
K-2000-100	2000	18.50	4	3	15	0.65	2	1	3	6.25	1.75
K-2500-100	2500	18.50	5	3	15	0.65	2	1.50	3	6.25	1.75
K-3000-100	3000	18.50	5	4	15	0.65	2	1.50	4	6.25	1.75
K-4000-100	4000	18.50	5	4	15	0.81	2.50	1.25	4	6.25	1.78
K-5000-100	5000	18.50	5	4	15	0.81	2.50	1.25	5	6.25	1.78
K-6000-100	6000	18.50	6	4	15.50	0.81	3	1.50	5	6.25	1.53

Tolerances  $\pm .015$  for the hole diameters. Other tolerances  $\pm .030$  unless specified.  
Dimensions subject to change without notice.



Crompton Technology Inc.  
7536 Bath Road  
Mississauga, Ontario L4T 1L2  
T (905)671-2304  
F (905)671-3661  
info@cromptoncanada.com  
www.cromptoncanada.com